

2007-2015 MX-5 WITH POWER RETRACTABLE HARDTOP (PRHT)

WIND NOISE FROM DRIVER'S DOOR

Some customers may complain about an air-/wind-type noise coming from the driver's door while driving approximately 30 mph or higher. This may be caused by poor door body sealing.



Repair

1. Inspect the area shown above.
2. If sealant is missing, add a bead of sealant to the area above showing "Inadequate body sealer".
3. Test drive the vehicle to confirm noise is no longer present.
 - a. No noise - Use vehicle color touchup paint to paint the added body sealant.
 - b. Noise is still there.
 - Check door seals
 - Check door alignment
 - Check PRHT alignment
 - Check for bent components (see M-Tip - 2008-2013 MX-5, Power Retractable Hardtop Will Not Open/Close and/or rattle-type noise)

An editorial board comprised of MNAO service staff members generates, collects, and verifies information for this publication. © 2015 Mazda Motor of America, Inc.

To contribute repair tip ideas, send an e-mail to mtips@mazdausa.com or fax to (949) 442-6599. If we select your repair tip, you will receive 10,000 Reward Performance by Mazda (RPM) points for your efforts. All contributions become property of MNAO, which assumes permission to publish them without further consideration.